

New Type ABS Wheel Speed Sensor

Vehicle Type: **911 Carrera (993)**
911 Turbo (993)

Model Year: **As of 1995 (S)**

Concern: Use of new type wheel speed sensor on front and rear axles.

Information: As of production date **November 24, 1995**, a new wheel speed sensor part number, 993 606 405 00, was introduced for use on all four wheels.

From VIN's:	99 6TS 321 385	911 Carrera Coupe
	99 2TS 340 914	911 Carrera Cabriolet
	99 XTS 385 216	911 Carrera Targa
	99 1TS 375 817	911 Turbo

Repairs: The former front axle wheel speed sensor part number, 993 606 404 00, and the former rear axle wheel speed sensor part number, 993 606 402 00, are no longer available. In case of required repairs, the new wheel speed sensor can be used in vehicles prior to above-production dates.

Caution: A mixing of former wheel speed sensors and the new wheel speed sensor on one axle is not approved. If a former wheel speed sensor needs replacement it will be necessary to update either both front or both rear sensors as applicable. Failure to adhere to this work procedure may lead to incorrect ABS function and illumination of the ABS warning lamp.

Parts Information: Printed part number on wire lead

993 606 405 00	New wheel speed sensor, front and rear
900 067 117 09	Bolt M6x16mm, no change
993 606 404 00	Former sensor, front, no longer available
993 606 402 00	Former sensor, rear, no longer available

Literature: Workshop manual 911 Carrera (993), Volume IV from page 45-11 and Volume VIII page 45-23 and Volume VIII from page 45-37.

Note: The new wheel speed sensor description for front and rear axles will be included in future workshop manual supplement updates. The current information regarding diagnosis, removal, and installation is still valid for the new wheel speed sensor.

Important Notice: Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.
 ©1997 Porsche Cars North America, Inc.

Dealership	Service Manager _____	Shop Foreman _____	Service Technician _____	_____	_____	_____	_____
Distribution	Asst. Manager _____	Warranty Admin. _____	Service Technician _____	_____	_____	_____	_____
Routing							

The trademarks Porsche®, Targa®, Carrera®, Boxster®, Tiptronic®, Varioram® and the Porsche Crest are registered trademarks of Dr. Ing. h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.