

Creaking Noise In Clutch Bell Housing Area

Vehicle Type: **911 Carrera (996)/911 Carrera 4 (996)**

Model Year: **As of 1999 (X)**

Concern: **Creaking noise coming from clutch bell housing area.**

Information: When the clutch is activated, creaking noises can occur in the area of the clutch release collar. The clutch release lever has been modified to eliminate the noise. In the event of a complaint, the release lever along with the other listed parts must be replaced. The modified release lever was installed in production on April 19, 2000 from the following transmission number: G9600 1018220.

When installing the new release arm, follow the following points:

- The existing installed adapter, part number, 012 141 751 A, is no longer necessary.
- Insert the sealing ring into the ball journal recess on the release lever and fasten with the retaining spring.
- Do not grease the ball journal or the ball journal recess.
- Coat the guide tube on the sliding surface of the release bearing with the paste "Optimol MPO".
- Grease the contact point between the release bearing and the release lever with the grease "Olista Longtime 3EP".

Parts Information:	Part Number	Description
	996 116 712 04	Release lever (modified)
	996 116 716 02	Ball journal
	996 116 741 00	Retaining spring (clip)
	996 116 743 00	Sealing ring
	999 917 788 00	Optimol MPO (enough to many vehicles)
	000 043 024 00	Olista Longtime 3EP (enough to do many vehicles)

Working Time:	Labor Operation	Time Units	Description
	34 35 19 00	330 TU	Removing/Installing transmission (Carrera)
	34 35 19 00	370 TU	Removing/Installing transmission (Carrera 4)
	30 45 19 50	20 TU	Removing/Installing release bearing Includes: removing/Installing release lever and ball journal.

Literature: *911 Carrera Technical Manual, Group 3:*
Repairs: 30 50 37 – Disassembling/assembling clutch.
Technical Information – No. 2/00 – Clutch pedal noises

Important Notice: Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.

©2000 Porsche Cars North America, Inc.

Dealership Distribution Routing	Service Manager _____ Asst. Manager _____	Shop Foreman _____ Warranty Admin. _____	Service Technician _____ Service Technician _____	_____	_____	_____	_____
---------------------------------------	--	---	--	-------	-------	-------	-------

Porsche, the Porsche marque, Carrera, Boxster, Tiptronic, VarioCam, VarioRam, Tequipment and PCM are registered trademarks. The 911 and the distinctive shapes of the Porsche automobiles are trademarks of Dr. Ing. h.c.F. Porsche AG.