

Headlamp Bracket Deformity

Vehicle Type: **911 Carrera (993), 911 Turbo (993) without Litronic headlight option**

Model Year: **911 Carrera, as of 1995 (S)
911 Turbo, as of 1996 (T)**


Concern: **Bracket for H1 headlamp (low beam) becoming deformed from heat.**

Information: The H1 lamp for low beam operation can become loose if the mounting area becomes deformed from heat. A new H1 lamp spring clip and retaining bracket are available, should this occur.


A repair kit, consisting of a stainless-steel spring clip and a modified retaining bracket should be installed, either as a preventative measure or a repair for deformity or warpage.

Parts Info.:	Part Number	Description
	000 043 204 28	Repair kit, with 1 spring clip and 1 retaining bracket

Work Procedure: Remove former H1 spring clip. Install new spring clip. Push the retaining bracket over the base area of the spring clip mounting. The retaining bracket must fully engage onto the lamp housing.

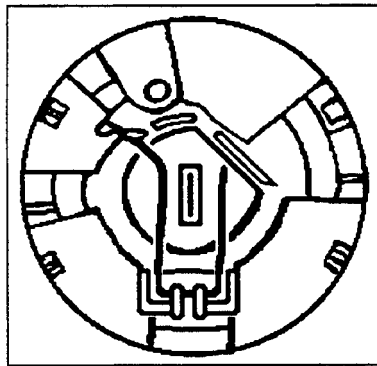

Former Arrangement

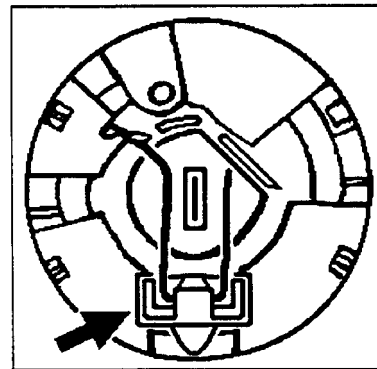

New Arrangement

Important Notice: Porsche Cars N.A Technical Bulletins are intended for use by professional technicians, not a "Do-it-yourselfer." They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Special tools may be required to perform certain operations identified in these bulletins. Use of tools and procedures other than those recommended in these bulletins may be detrimental to the safe operation of your vehicle. Properly trained technicians have the equipment, tools, safety instructions and know-how to do a job properly and safely. If a condition is described, do not assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your Porsche Dealer for information on whether your vehicle may benefit from the information. Part numbers listed in these bulletins are for reference only. Always check with your authorized Porsche dealer to verify correct part numbers.

©1999 Porsche Cars North America, Inc.

Dealership	Service Manager _____	Shop Foreman _____	Service Technician _____	_____	_____
Distribution	Asst. Manager _____	Warranty Admin. _____	Service Technician _____	_____	_____
Routing					

The trademarks Porsche®, Targa®, Carrera®, Boxster®, Tiptronic®, Varioram® and the Porsche Crest are registered trademarks of Dr. Ing. h.c.F. Porsche AG and its affiliate, Porsche Cars North America, Inc.